




KEY TO INTERNAL REPAIRS:

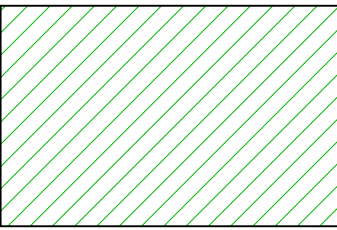


Lime plaster repairs to external walls as M20

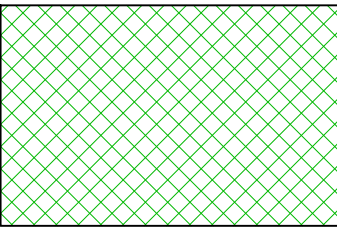


De-frass loose Forest of Dean Pennant stone and remove decaying limewash as C41 prior to new limewash coatings as M60

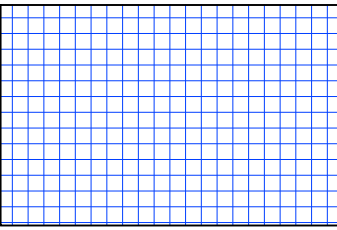


Piece in new sections of Forest of Dean Pennant stone around first floor timber beams and new recessed concrete padstones, and locally repoint in lime mortar as Z21

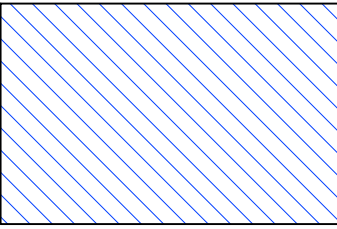


ThermaTech masonry cleaning to remove modern paint finishes as C40




Reinstate missing moulded ogee profiles to the perimeter edge and underside of the coffered ceiling and match the existing. Timber profiles to be decorated as M60




Decorative ironwork missing sections replacement and repairs to be undertaken by specialist metalworker with working method statements to be provided and agreed with the CA

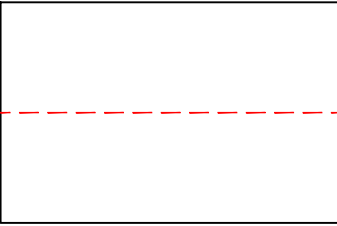


Modern building fabric to be carefully removed as C20

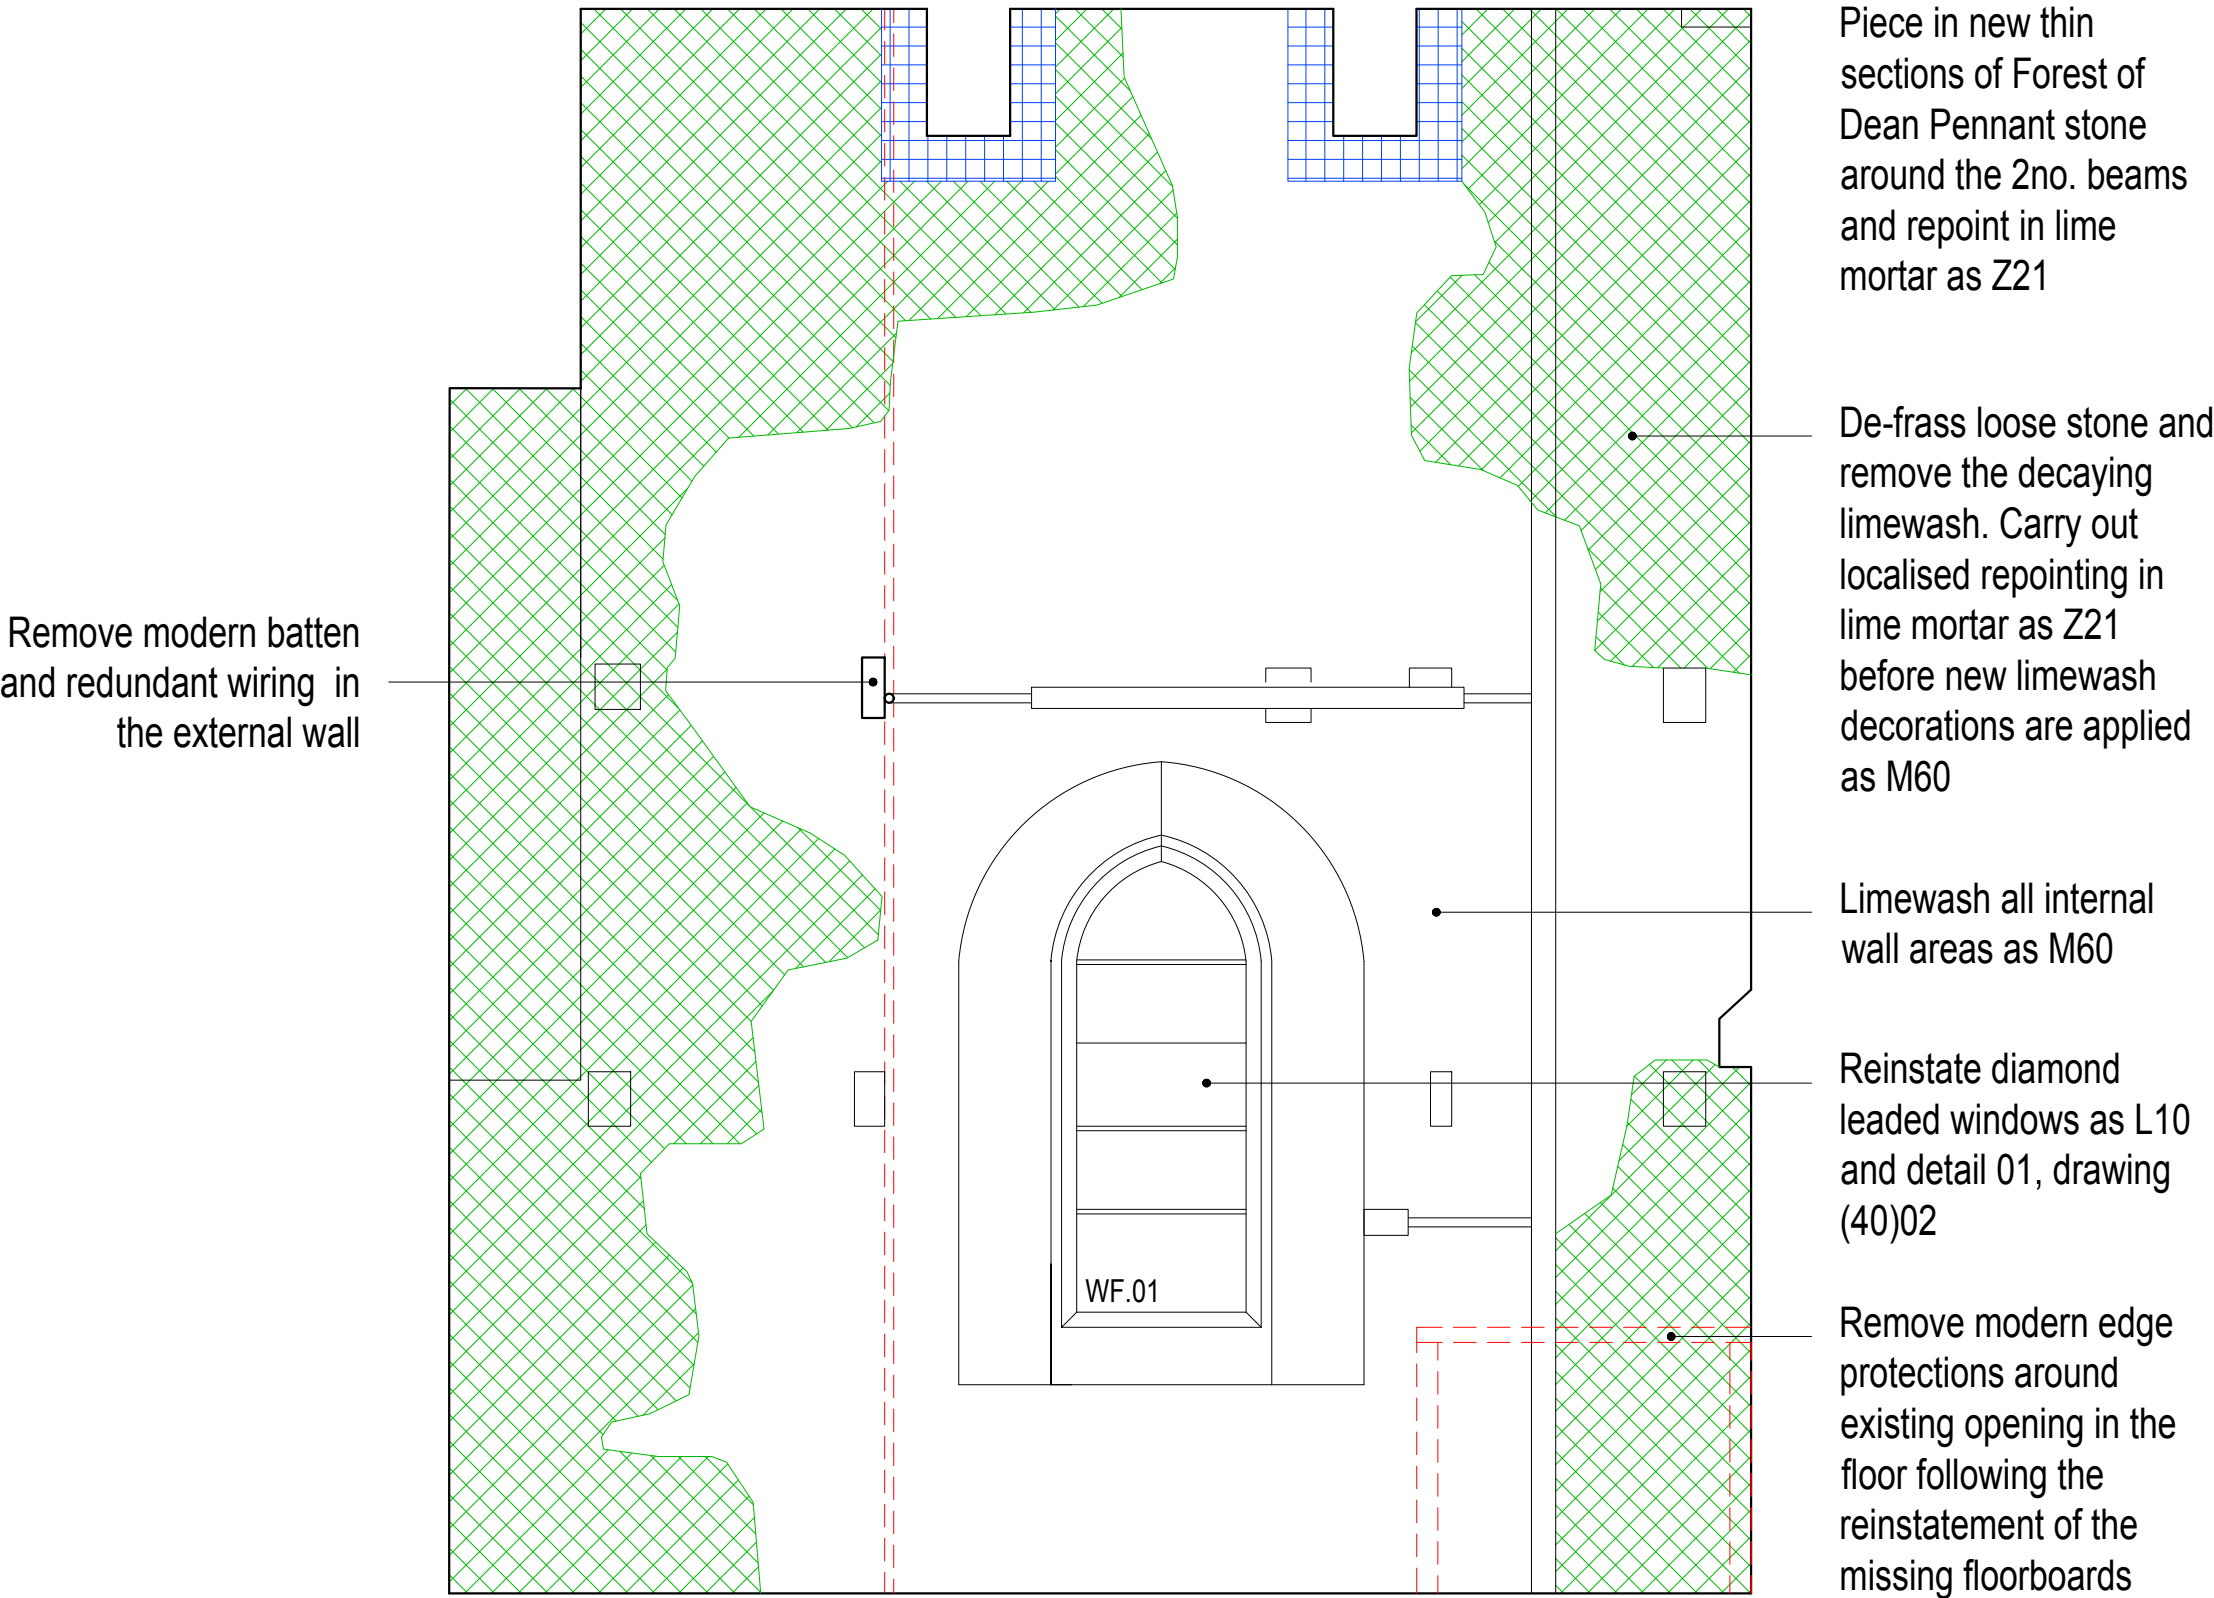


1 SOUTH INTERNAL ELEVATION
(22)02 1:25

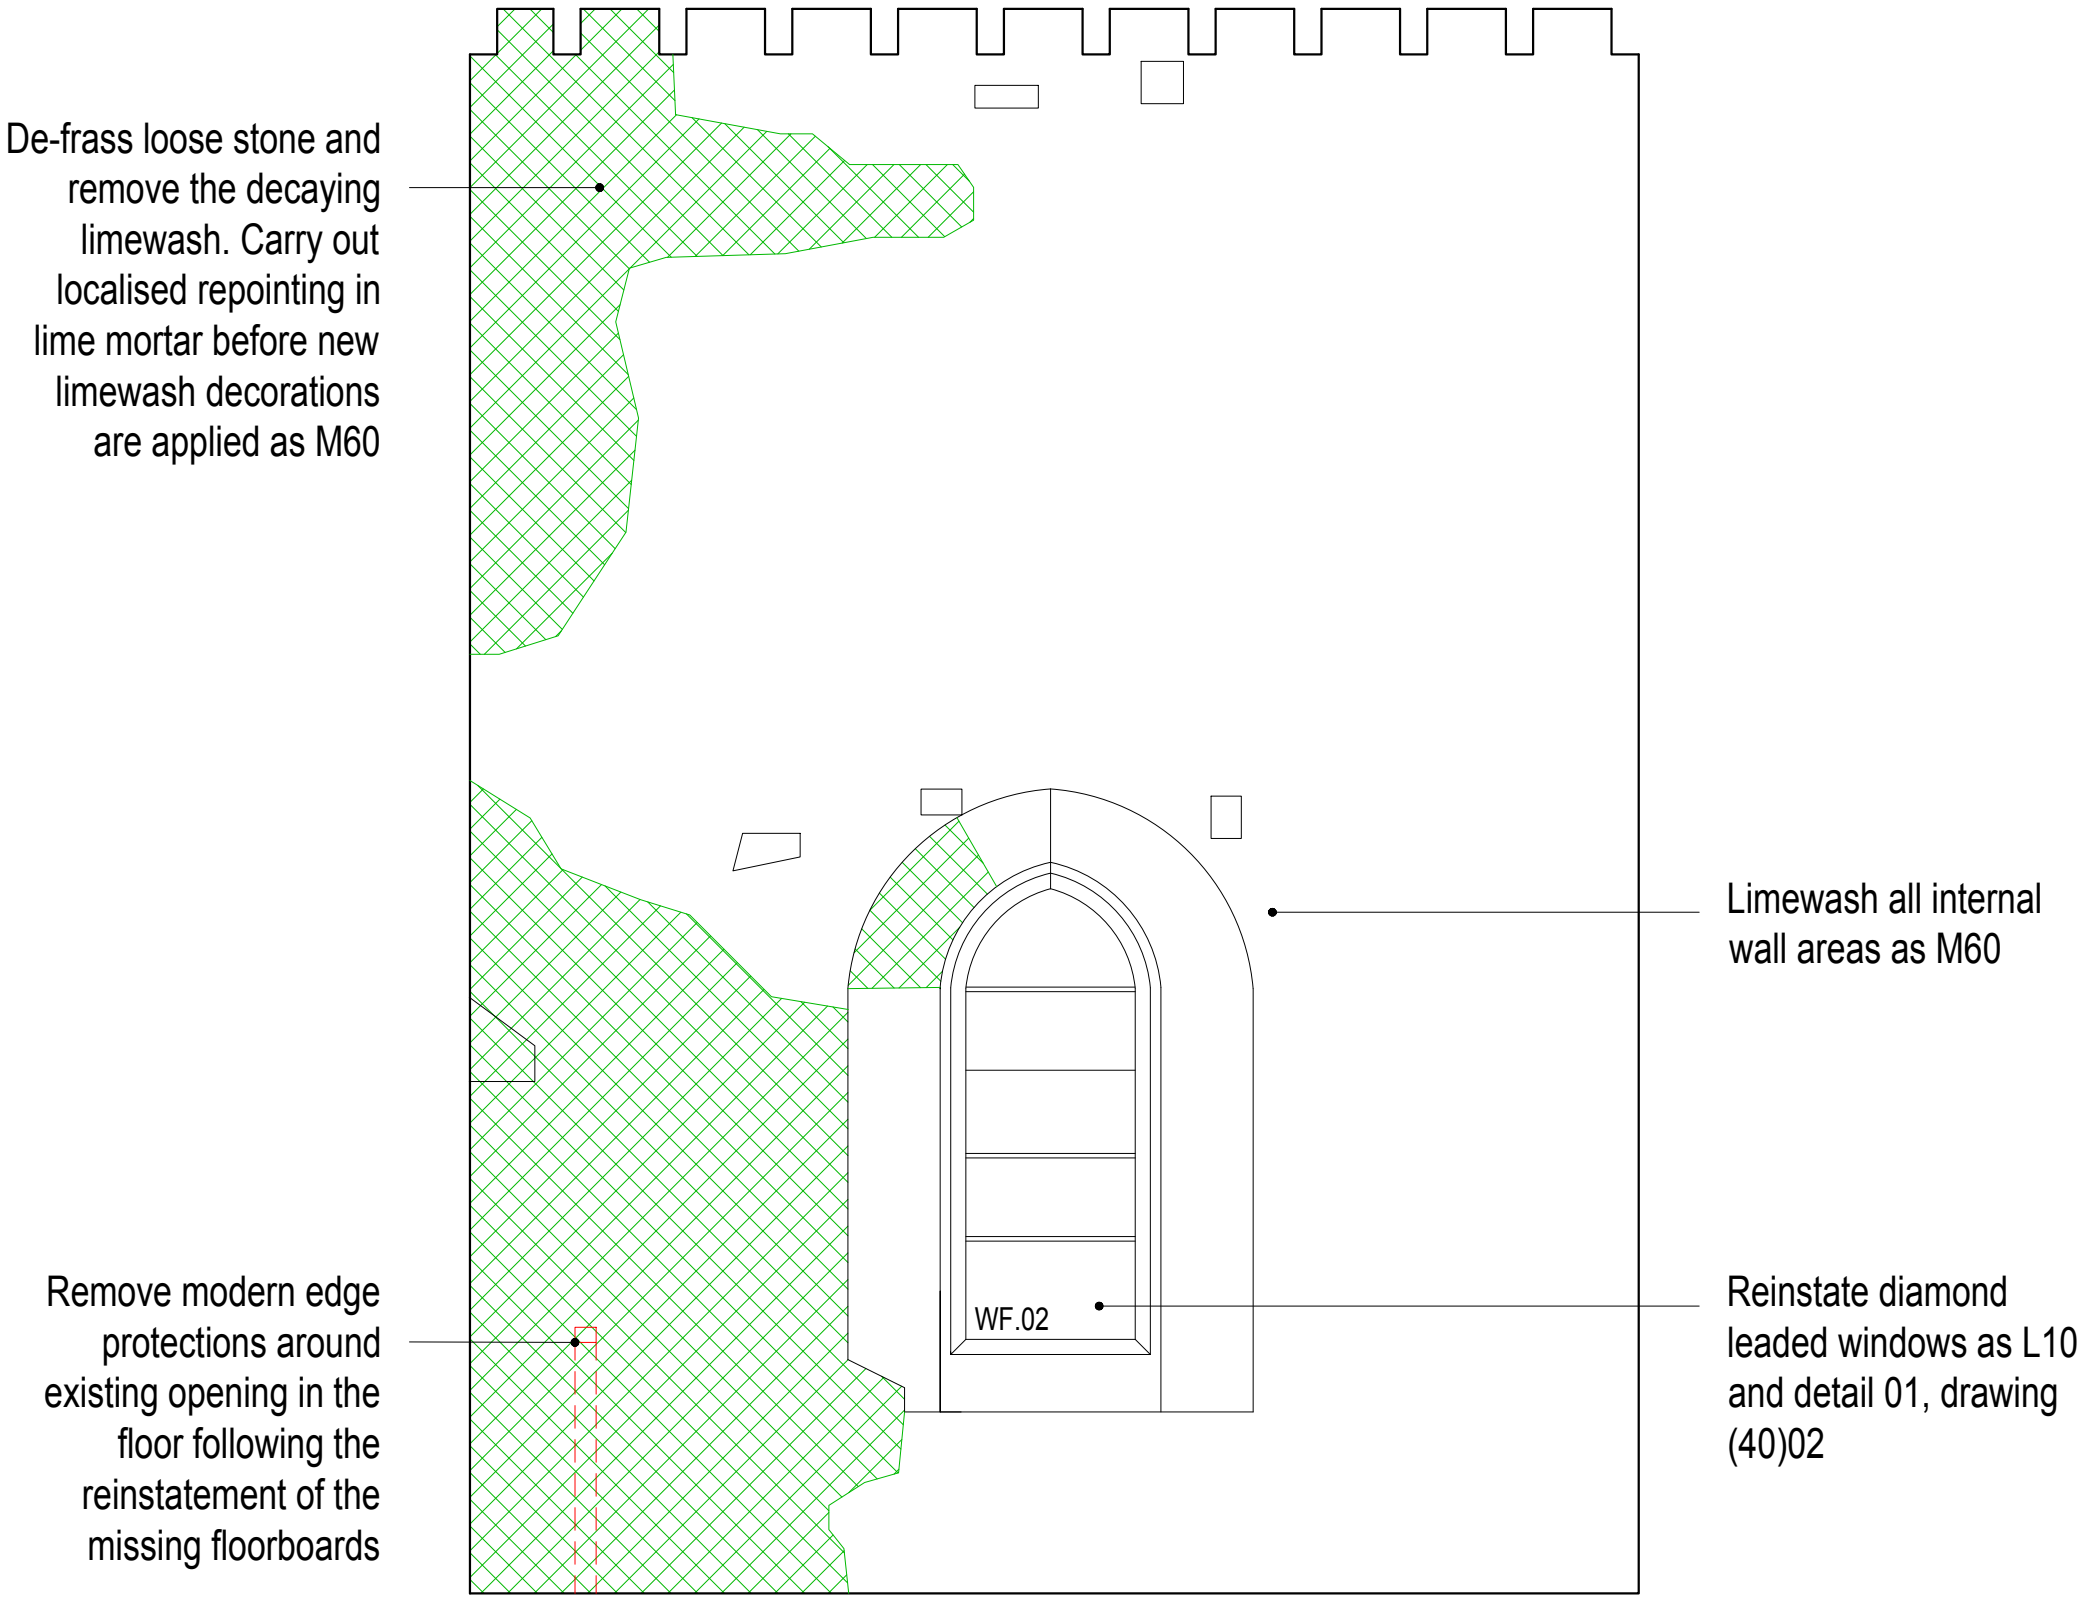

2 WEST INTERNAL ELEVATION
(22)02 1:25

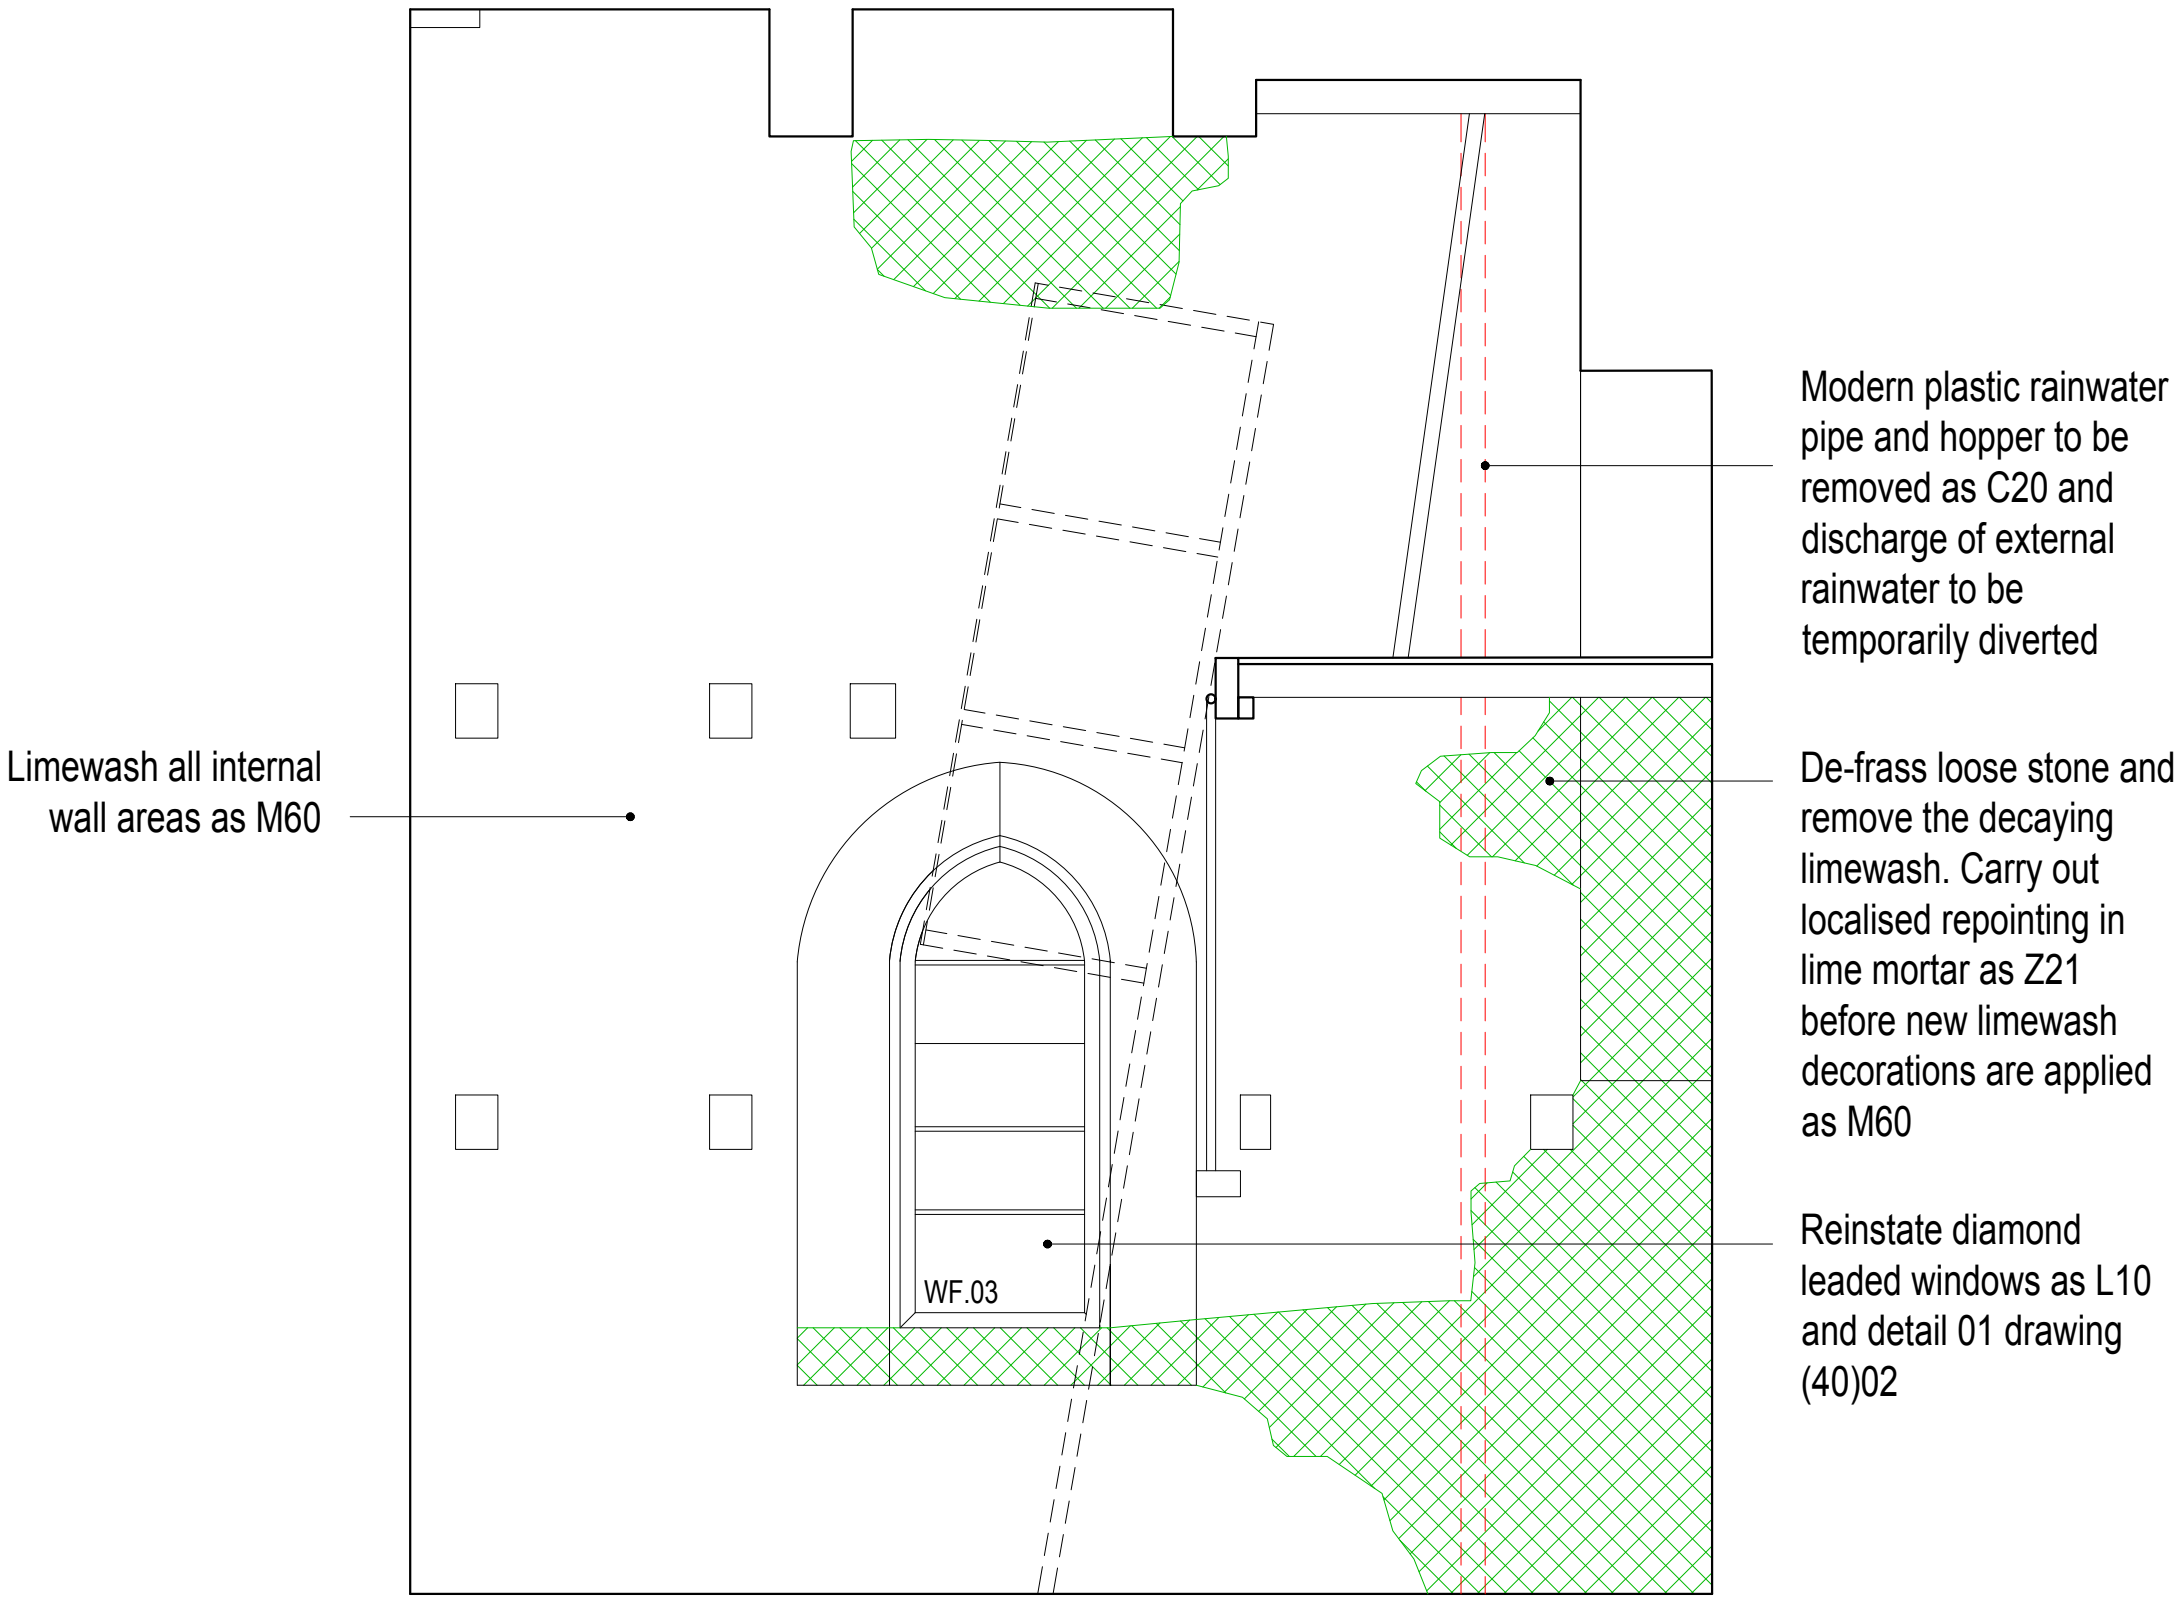

3 NORTH INTERNAL ELEVATION
(22)02 1:25

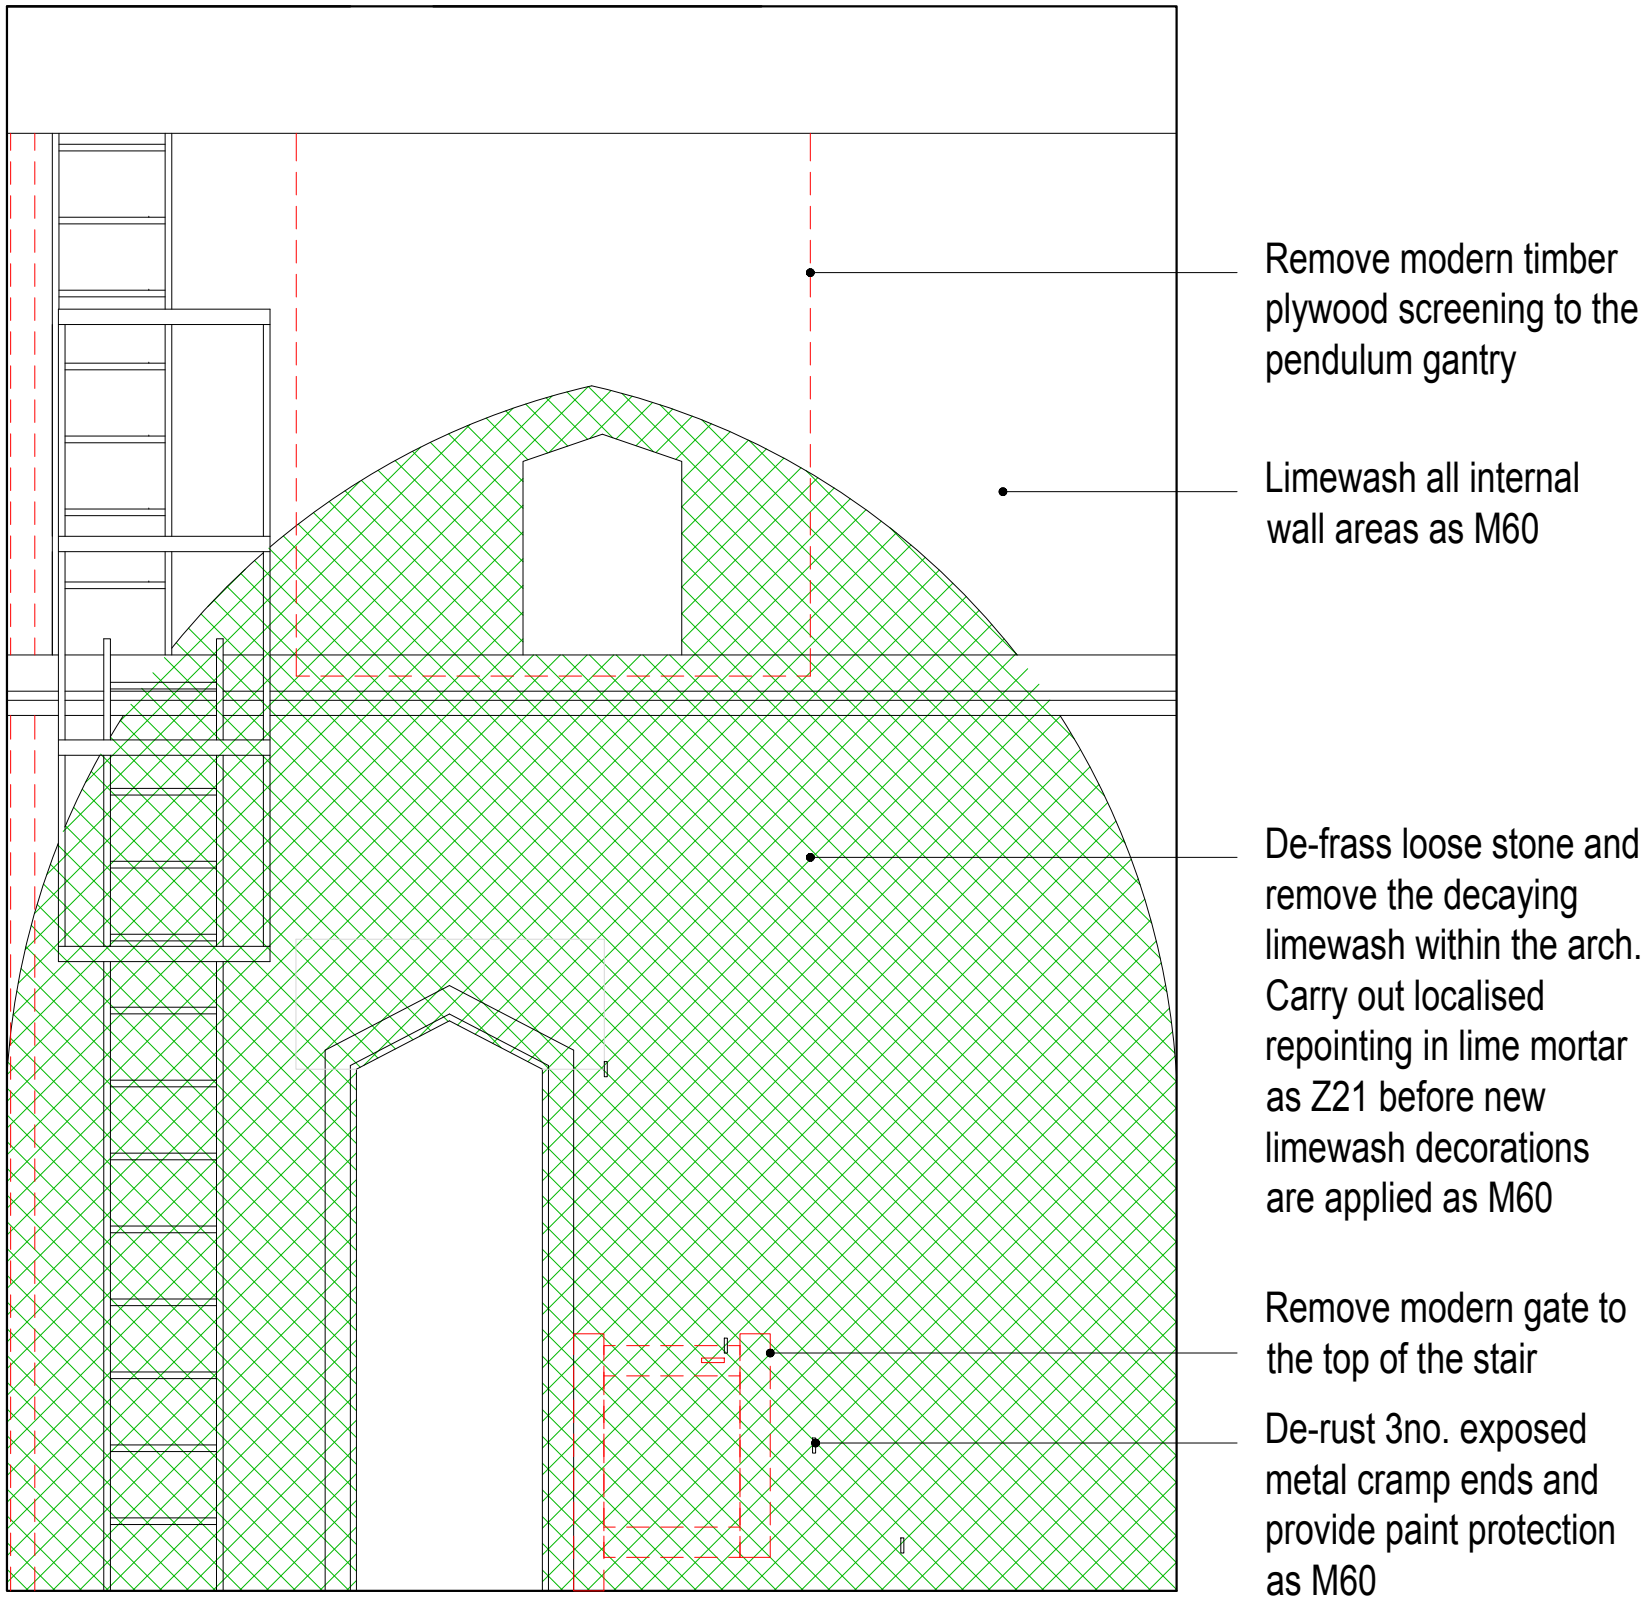

4 EAST INTERNAL ELEVATION
(22)02 1:25

Key to Drawing

Modern building fabric to be removed as C20

Do not scale for construction purposes. The contractor shall check and verify all dimensions on site before ordering any components or fittings and any such are to be installed to the manufacturer's recommended details. Please note that these Building Regulations drawings show design intent only and construction is the responsibility of the contractor. All drawings are copyright of DHV Architects and shall not be reproduced without their consent.

0 1 m

ISSUED FOR TENDER

Studios 12-13, 9 Bath Buildings, Bristol, BS6 5PT
info@dhva.co.uk www.dhva.co.uk T 0117 914 8317

Job Title Coleford Clock Tower
Client Coleford Town Council
Scale 1:25@A1/ 1:50@ADF

dittrichhudsonvasettia

Internal Repair Elevations
First Floor
Job No 1398
Checked OF
Date (22)02