


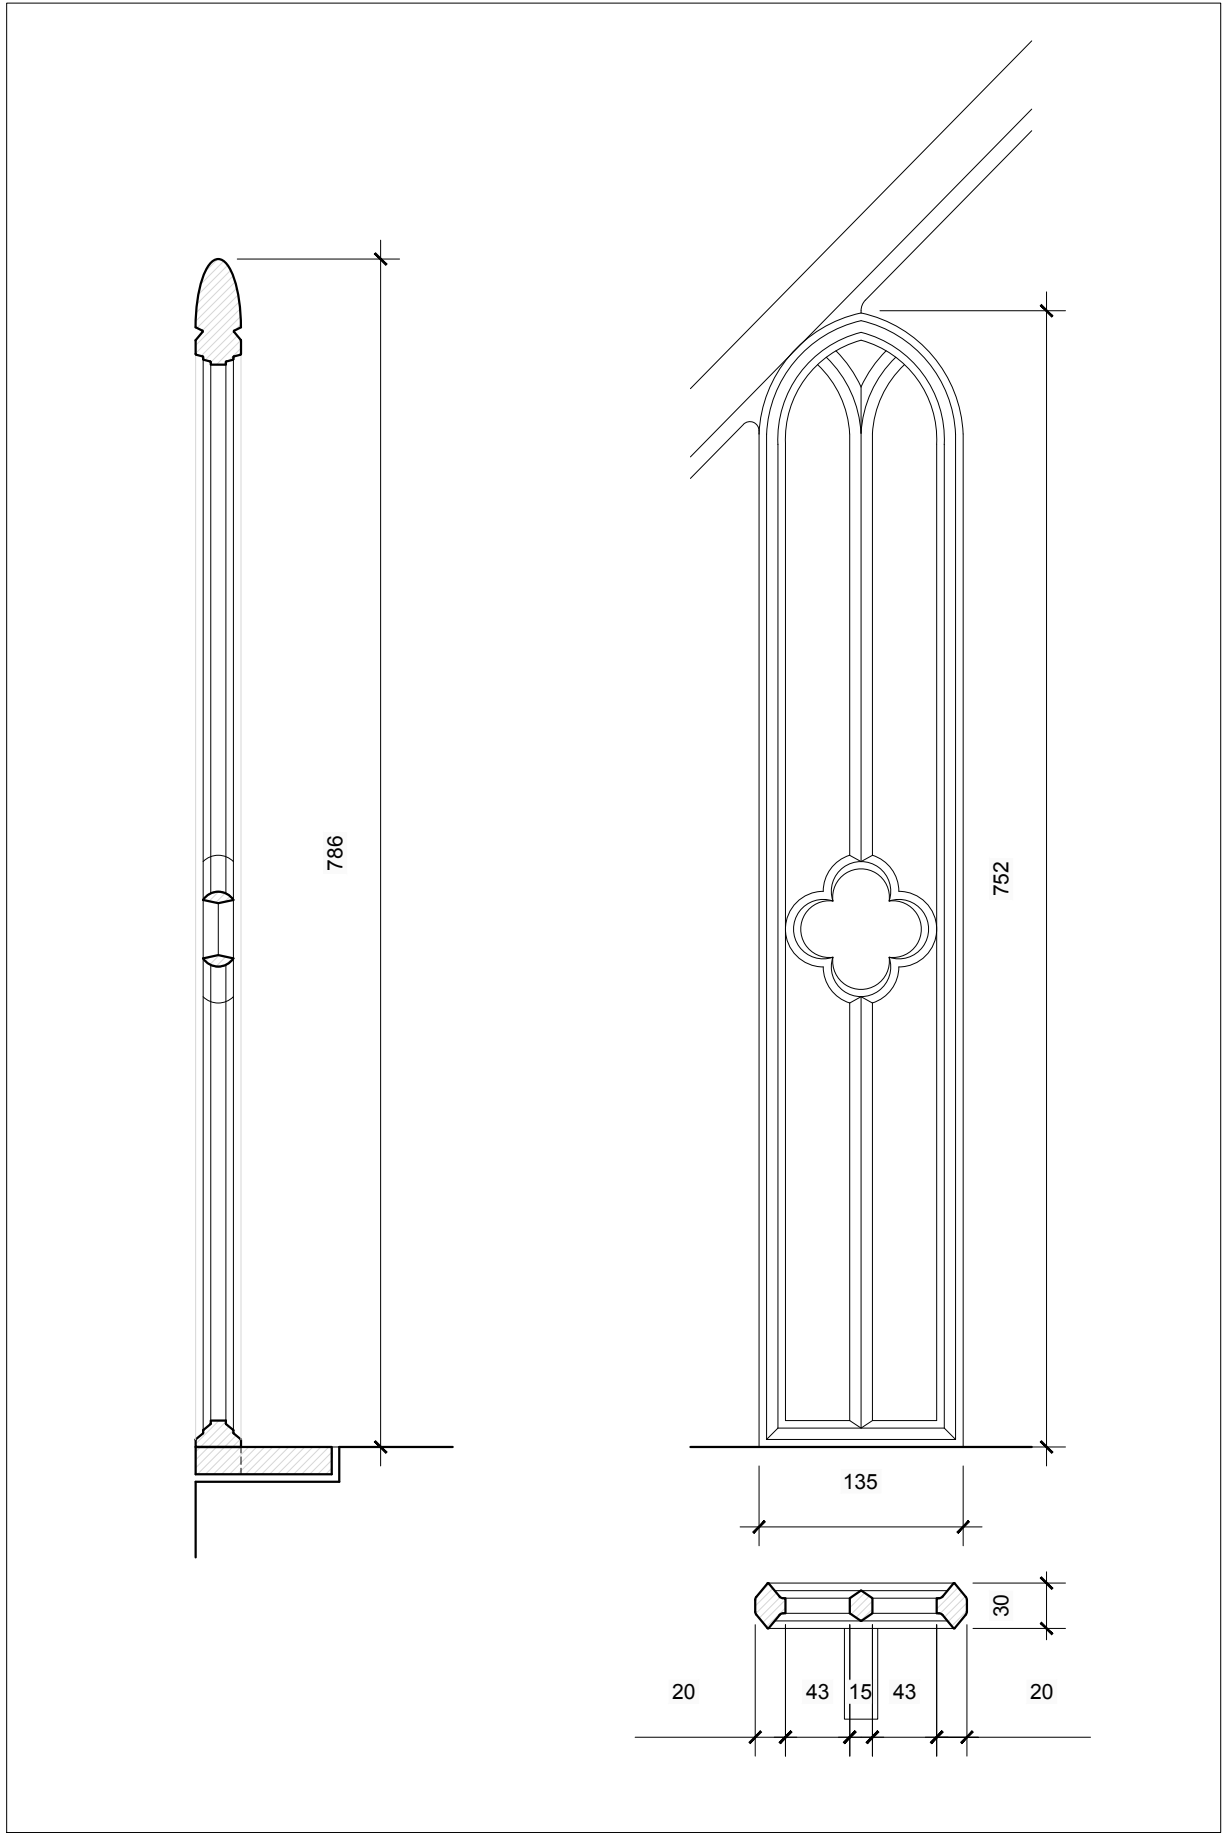
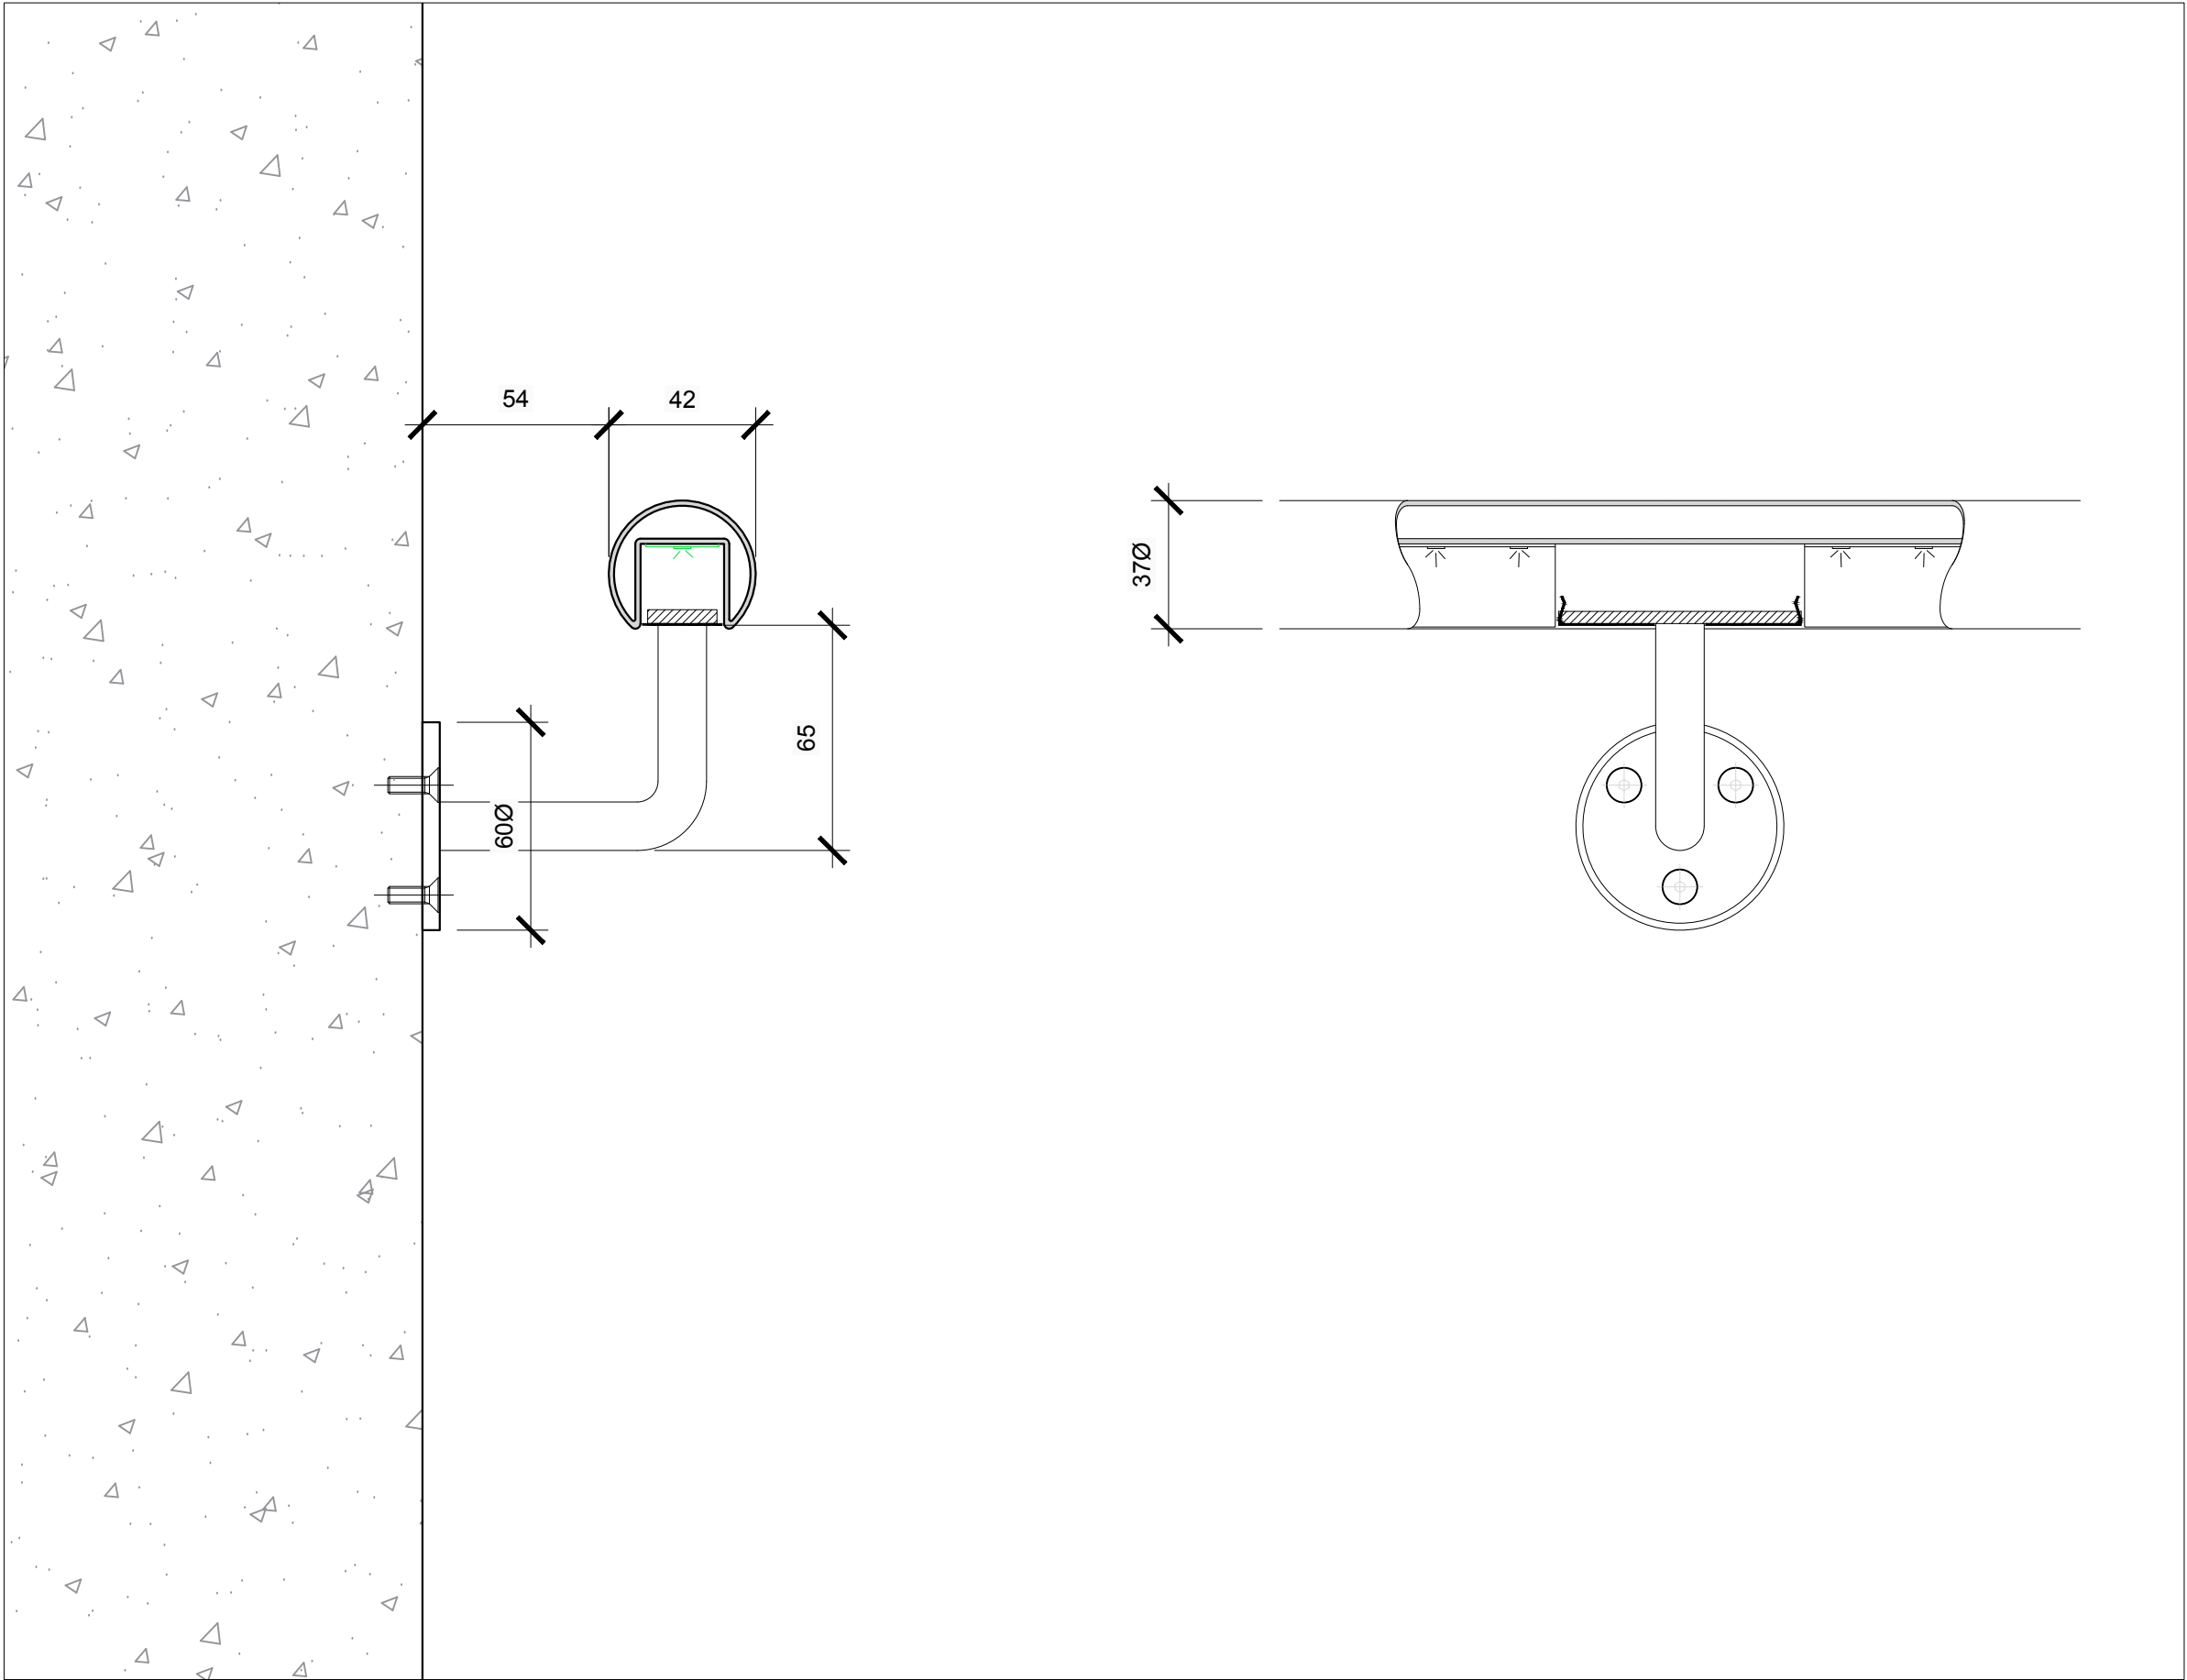


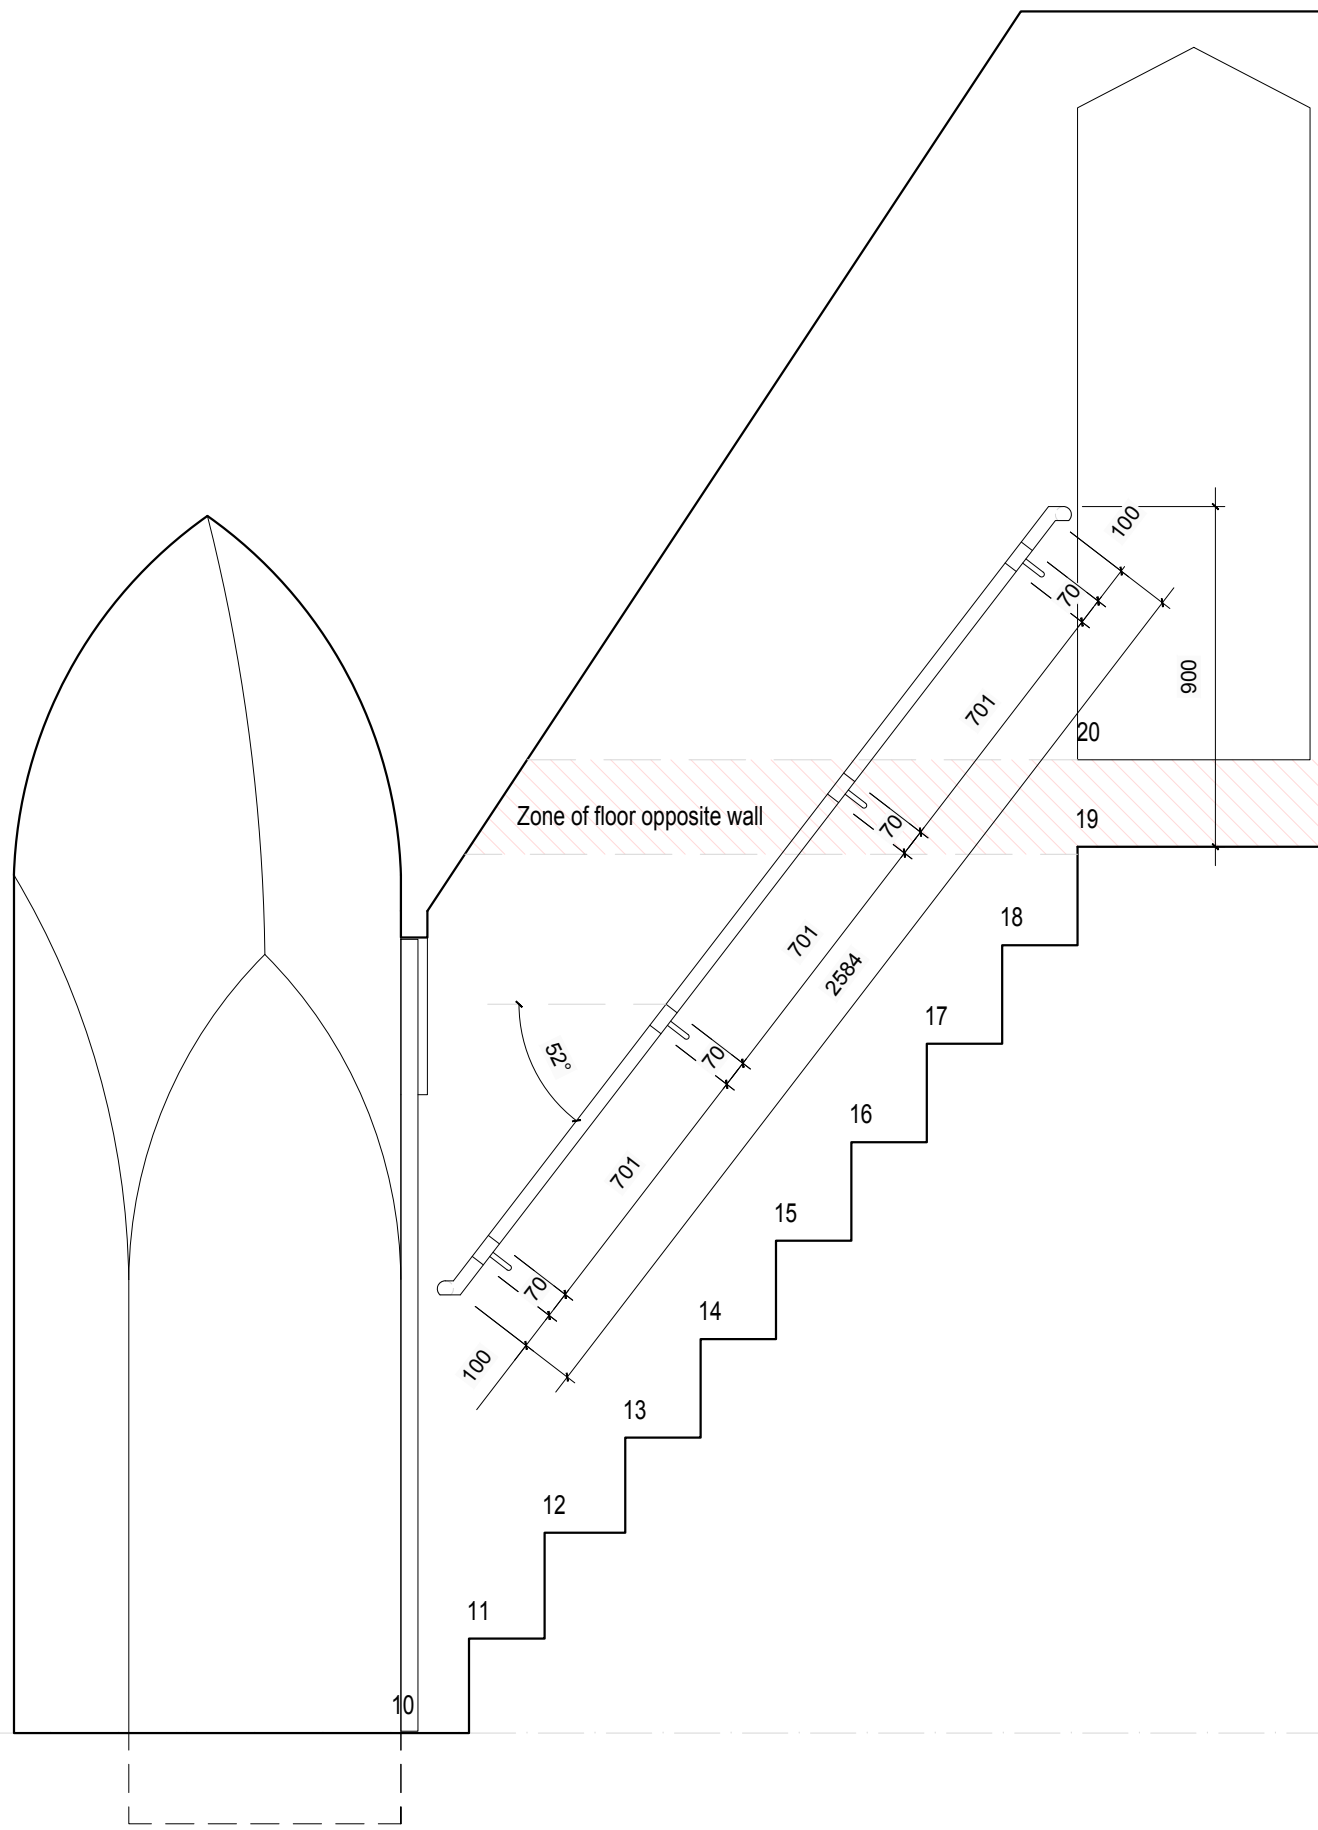

1 STG.01 and STG.02 ENLARGED DETAILS
(50)02 1:5

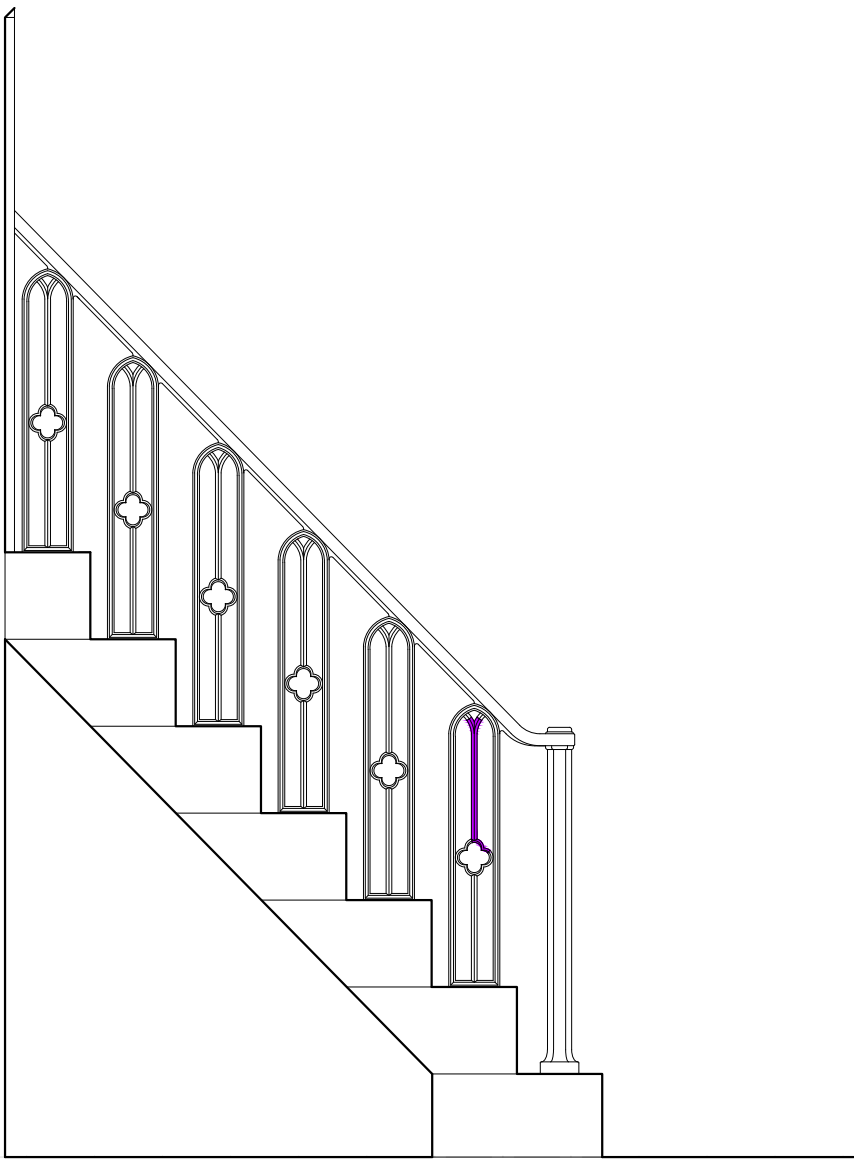

2 H1 ENLARGED DETAILS
(50)02 1:2

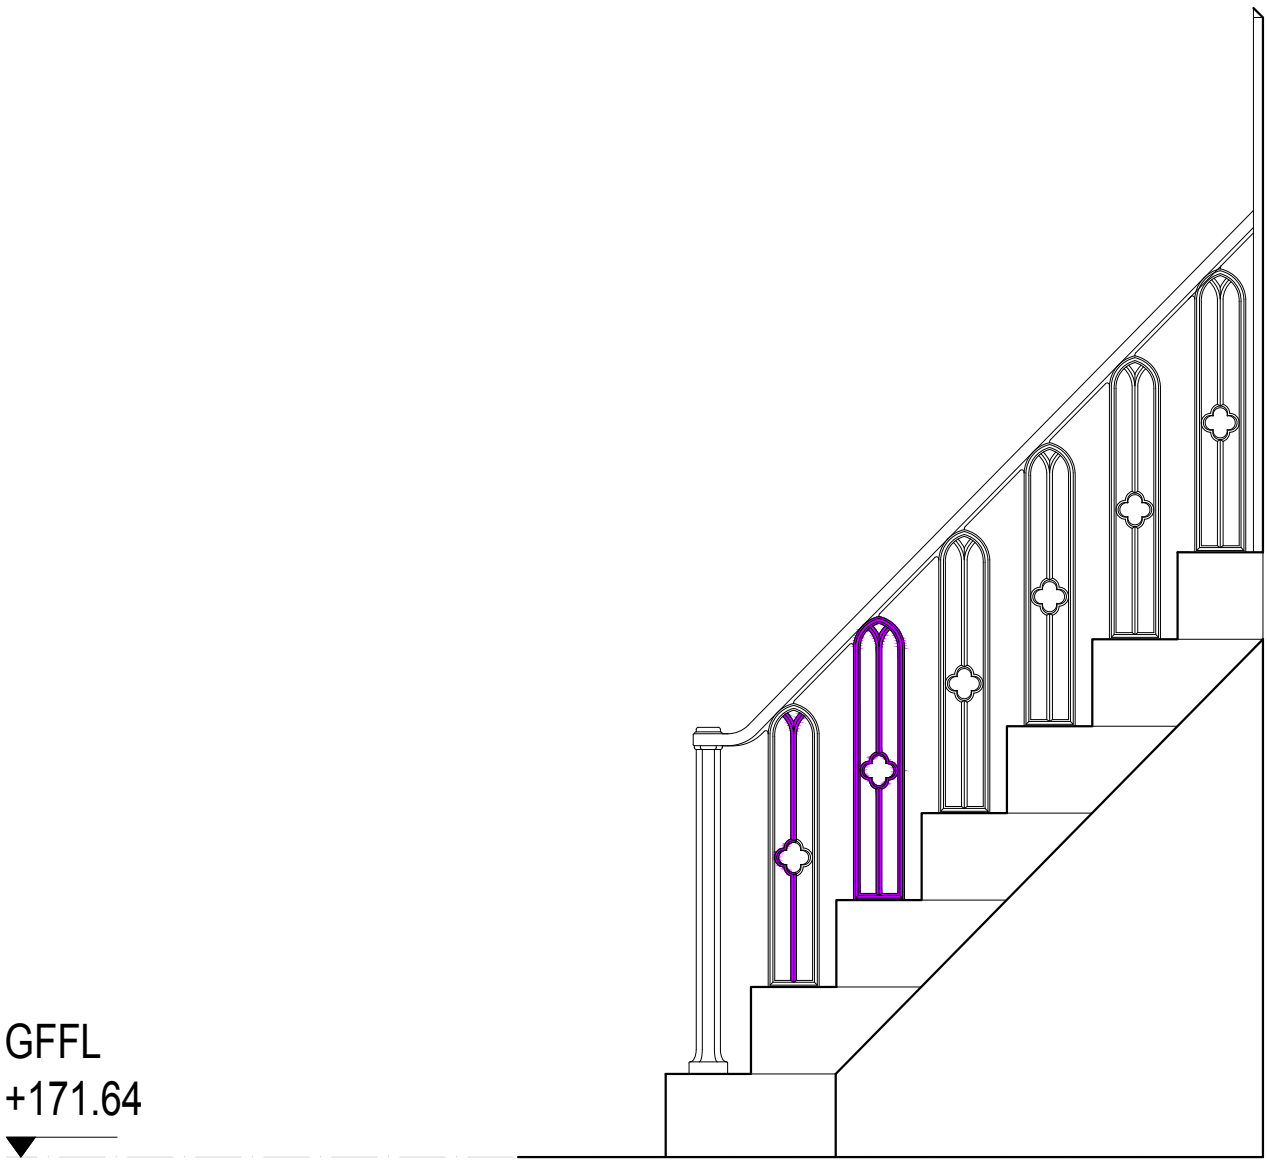

JOINERY ITEM
NUMBER

STG.01

STG.02

H1

NOTES

GF.01 Tower Porch
Specialist repair work by metal conservator. Propose method of repair and submit details to be agreed with the CA.
Repairs as highlighted and see drawing 1398 (22)01

GF.01 Tower Porch
Specialist repair work by metal conservator. Propose method of repair and submit details to be agreed with the CA.
Repairs as highlighted and see drawing 1398 (22)01

FF.02 Inter-Mural Stair
Glowrail integrated LED handrail by the Light Lab.
Glowrail 42, standard output, IP40, 48VDC constant voltage, 3000K LED, DALI dimmable control. Handrail finish - AM Aged Bronze c/w Aged Bronze stainless steel wall mounted brackets. Power to be supplied through third bracket from the bottom of the floor to align with power containment in the floor void behind. No wires are to be visible in the stair

3 INTERNAL STAIR HANDRAIL SCHEDULE
(50)02 1:20

ISSUED FOR TENDER									
Studios 12-13, 9 Bath Buildings, Bristol, BS6 5PT E info@dhva.co.uk W www.dhva.co.uk T 0117 914 8317									
dittrichhudsonvasettiaarchitects									
Job Title		Internal Stair Handrail Schedule as Proposed							
Client		Coleford Town Council							
Scale		As shown @ A1		Drawn	OF	Checked	OF	Job No	1398
								Orig No	(50)02
								Rev	